

Immediate Action Required



Products:

Select 3M™ DBI-SALA® Ultra-Lok™ Self-Retracting Lifelines



3M is issuing this "**Stop Use/Remediate**" notice for select 3M[™] DBI-SALA® Ultra-Lok[™] Self-Retracting Lifelines




As part of 3M's ongoing commitment to delivering high quality products, we are notifying our customers of the following information related to select 3M™ DBI-SALA® Ultra-Lok™ Self-Retracting Lifelines. 3M Fall Protection has identified a potential supplied raw material issue in select 3M™ DBI-SALA® Ultra-Lok™ Self-Retracting Lifelines produced between November 17, 2023, and June 14, 2024. 3M has determined that in the event of a fall and under certain conditions, these devices may not lock up properly or prevent retrieval models from going into retrieval mode which could expose the worker to serious injury or death. There have been no reports of accidents or injuries associated with this issue.

Due to this, we are sending out this Stop Use and Remediate notice, so the select 3M™ DBI-SALA® Ultra-Lok™ Self-Retracting Lifelines are removed from service immediately. Failure to read and follow all instructions associated with this Notice may result in serious injury or death of a user. Instructions for appropriate next steps are below, see the appendix for a complete list of models impacted by this stop use notice.

End Users

Please follow the steps listed below:

Step 1: Locate the model number, manufacture date, and lot number on the device information label (see Photo 1). If your device model number and manufacture date or lot number is listed in the appendix, proceed to step 2. If your device model number and manufacture date or lot number is not listed in the appendix, it is not impacted by this notice.

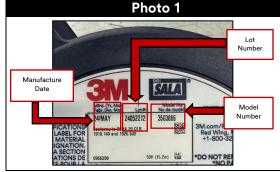

Step 2: Please submit a request to have your device(s) repaired by our 3M's Service Center by completing the SRL Repair Request form in the QR code to the right. Our 3M Service Center will repair your device (s). The repair and shipping will be at 3M's expense. Once you submit your request, 3M's Block Repair Customer Service department will email your repair authorization number and return shipping instructions.



Distributors

Upon receipt of this Notice, please contact your 3M Fall Specialist for a listing of the impacted products sold to you. If you have any of the impacted 3M™ DBI-SALA® Ultra-Lok™ Self-Retracting Lifelines in stock, please submit a distributor stock repair request by completing the Stock Repair Request form in the QR code to the right. Our 3M Service Center will repair and return your stock. The repair and shipping will be at 3M's expense. Once you submit your request, our Block Repair Customer Service department will email the stock repair authorization number and return shipping instructions. Please immediately forward this Notice to any of your customers who have purchased impacted products from you and provide any assistance requested by your customers to complete the process.



3M Fall Protection www.3M.com



Appendix



Impacted 3M™ DBI-SALA® Ultra-Lok™ Self-Retracting Lifelines and Associated Tripod Systems							
3M ID	Model Number	Description	Manufacture Date	Lot Number	Product Image		
7012819270	3503882	3M™ DBI-SALA® Ultra-Lok™ Self-Retracting Lifeline 3503882, Stainless Steel Cable, 50 ft	NA – Only specific lots impacted	24052272 24062472			
7012819274	3503886	3M™ DBI-SALA® Ultra-Lok™ 3-Way Retrieval Self-Retracting Lifeline with Bracket 3503886, Galvanized Cable, 50 ft	November 2023 – June 2024	All lots produced within the specified manufacture date range are impacted by this notice			
7012828698	3503887	3M™ DBI-SALA® Ultra-Lok™ 3-Way Retrieval Self-Retracting Lifeline with Bracket 3503887, Stainless Steel Cable, 50 ft	November 2023 – June 2024	All lots produced within the specified manufacture date range are impacted by this notice			
7012819276	3503889	3M™ DBI-SALA® Ultra-Lok™ RSQ Self-Retracting Lifeline 3503889, Stainless Steel Cable, 50 ft	NA – Only specific lots impacted	24052272 24062572			



Appendix



3M ID	Model Number	DBI-SALA® Ultra-Lok™ Se	Manufacture Date	Lot Number	Product Image
7100328027	8301076	3M™ DBI-SALA® Confined Space Aluminum Tripod with Winch and 3-Way SRL 8301076, 60 ft (Winch), 50 ft (SRL), Galvanized Cable	November 2023 – June 2024	All lots produced within the specified manufacture date range are impacted by this notice	Self- Retracting Lifeline Installed 3503886
7100328028	8301077	3M™ DBI-SALA® Confined Space Aluminum Tripod with Winch and 3-Way SRL 8301077, 60 ft (Winch), 50 ft (SRL), Stainless Steel Cable	November 2023 – June 2024	All lots produced within the specified manufacture date range are impacted by this notice	Self- Retracting Lifeline Installed 3503887
7100327770	8301078	3M™ DBI-SALA® Confined Space Aluminum Tripod with Winch and 3-Way SRL 8301078, 60 ft (Winch), 50 ft (SRL), Galvanized Cable	November 2023 – June 2024	All lots produced within the specified manufacture date range are impacted by this notice	Self- Retracting Lifeline Installed 3503886
7100327871	8301090	3M™ DBI-SALA® Confined Space Aluminum Tripod with 3- Way SRL 8301091, 7 ft Tripod, 50 ft Galvanized Cable	November 2023 – June 2024	All lots produced within the specified manufacture date range are impacted by this notice	Self- Retracting Lifeline Installed 3503886
7100327872	8301091	3M™ DBI-SALA® Confined Space Aluminum Tripod with 3- Way SRL 8301091, 7 ft Tripod, 50 ft Stainless Steel Cable	November 2023 – June 2024	All lots produced within the specified manufacture date range are impacted by this notice	Self- Retracting Lifeline Installed 3503887